

Make your own lashing from 2000 to 10000 kp
Optimize the webbing length and save money

Buckle & Webbing

System



WG-buckle

Buckle Part no.:

Type:
Breaking strenght kp:
Alt 1: Webbing Part no.
Breaking strenght kp:
Alt 2: Webbing Part no.
Breaking strenght kp:

682003510

WG-buckle 35 mm, d=7 mm
1400
680000030
2000
680000032
2300



Alt 1: LC = 650 kp

Alt 2: LC = 700 kp

Buckle Part no.:

Type:
Breaking strenght kp:
Webbing Part no.:
Breaking strenght kp:

682004010

WG-buckle 40 mm, d=7 mm
1400
680000038
3500

LC = 700 kp

Buckle Part no.:

Type:
Breaking strenght kp:
Webbing Part no.:
Breaking strenght kp:

682004020

WG-buckle 40 mm, d=10 mm
1600
680000038
3500

LC = 800 kp




A-lock buckle

Buckle Part no.:

Type:
Breaking strenght kp:
Alt 1: Webbing Part no.
Breaking strenght kp:
Alt 2: Webbing Part no.
Breaking strenght kp:

01808

A-lock buckle 35 mm, welded
3000
02190S
2300
05090S
3000

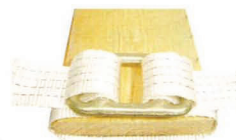

Alt 1: LC = 750 kp

Alt 1: LC = 1000 kp

Buckle Part no.:

Type:
Breaking strenght kp:
Webbing Part no.
Breaking strenght kp:

01807

A-lock buckle 40 mm, welded
5000
08091S
5000

LC = 1650 kp

Buckle Part no.:


Type:
Breaking strenght kp:
Alt 1: Webbing Part no.
Breaking strenght kp:
Alt 2: Webbing Part no.
Breaking strenght kp:

01805

A-lock buckle 50 mm, forged
5000
08090S
4800
12090S
7500

Alt 1: LC = 1600 kp

Alt 1: LC = 2500 kp

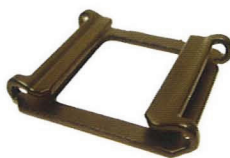

Key-lock buckle

Buckle Part no.:

Type:
Breaking strenght kp:
Alt 1: Webbing Part no.
Breaking strenght kp:
Alt 2: Webbing Part no.
Breaking strenght kp:

01800

Key-lock buckle 50 mm
2000
01835
2000
01840
3000



Alt 1: LC = 650 kp

Alt 1: LC = 1000 kp



Quicklash buckle

Buckle Part no.:

Type:
Breaking strenght kp:
Alt 1: Webbing Part no.
Breaking strenght kp:
Alt 2: Webbing Part no.
Breaking strenght kp:

01802

Quicklash buckle 50 mm
2000
01835
2000
01840
3000



Alt 1: LC = 650 kp

Alt 1: LC = 1000 kp